

FORM WR-38 (Affidavit of Plugging)

My commission expires:

Fredi 17 1497

STATE OF WEST VIRGINIA DEPARTMENT OF ENERGY OIL AND GAS WELLS DIVISION



DIMISION OF OIL & GAS DEPARTMENT OF ENERGY

AFFIDAVIT OF PLUGGING AND FILLING WELL

AFFIDAVIT SHOULD BE MADE IN TRIPLICATE, one copy mailed to the Division, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Eastern Associated Coal Corporation	Eastern Asso	ciated Coal Corpo	ration
Coal Operator or Owner		ame of Well Operation	
Route 1, Box 144, Fairview, WV 26570		144, Fairview. W	
Address	Route 1, Box	Complete Address	V 2037U
	June 27	•	19 88
Coal Operator or Owner	WELI	L AND LOCATION	
	Battelle		District
Address			•
Joseph S. Carrothers	Monongalia		County
Lease or Property Owner			•
1428 Cov. Road, Organ, Ohio	WELL NO. F2-	-410-EACC	
Address			
•	A. S. Carroth	ner No. 7 398 A	cres Farm
STATE INSPECTOR SUPERVISING PLUGGING Don E.	llis		
	•		
AFFIDAV	IT		
STATE OF WEST VIRGINIA,			-
County of Monongalia ss:			
•	and Mark Moor	•_	
peing first duly sworn according to law depos			nced in the
work of plugging and filling oil and gas well			
, well operator, and par			
ing the above well, that said work was commen	iced on the $\frac{26}{}$	oth day of May	
$19 \ 88$, and that the well was plugged and f	illed in the f	ollowing manner:	
Sand or Zone Record Filling Mate	riol	Divos Heed	0
	irai	Plugs Used	Casing
Formation Filling Mate	:IIaI	Size & Kind	1
	::141		Casing CSG CSG PULLED LEFT IN
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal	iper	Size & Kind	PULLED LEFT IN
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 45" pipe gelled hole with 27	iper	Size & Kind	PULLED LEFT IN
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s	iper 'sacks gell,	Size & Kind	PULLED LEFT IN
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27	iper 'sacks gell,	Size & Kind	PULLED LEFT IN
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation	iper 'sacks gell eacks gell and got	Size & Kind	PULLED LEFT IN
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Comp	iper 'sacks gell, sacks gell and got .pe to 1067'	Size & Kind	CSG CSG PULLED LEFT IN 1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047'	iper sacks gell acks gell and got pe to 1067'	Size & Kind 4矣" Pipe	CSG CSG PULLED LEFT IN 1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement,	iper sacks gell acks gell and got pe to 1067'	Size & Kind 45" Pipe	CSG CSG PULLED LAFT II 1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation	iper sacks gell acks gell and got pe to 1067'	Size & Kind 4½" Pipe	CSG CSG PULLED LAFT II 1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation	iper sacks gell acks gell and got pe to 1067'	Size & Kind 44: Pipe	106
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation	iper 'sacks gell acks gell and got pe to 1067' procement run 200	Size & Kind 44:" Pipe Division of Contraction of	1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation	iper 'sacks gell acks gell and got pe to 1067' procement run 200	Size & Kind 44: Pipe JUN 28 DIVISION OF C	1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation	iper 'sacks gell acks gell and got pe to 1067' procement run 200	Size & Kind 44:" Pipe Division of Contraction of	1988 DL & GAS DE ENERGY
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams	iper 'sacks gell acks gell and got pe to 1067' procement run 200	Size & Kind 42" Pipe JUN 28 DIVISION OF COMPARTMENT	1988 DL & GAS DE ENERGY Monument
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name)	iper 'sacks gell sacks gell and got pe to 1067' pp cement run 200	Size & Kind 44:" Pipe DIVISION OF CONTROL	1988 1988
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name) (Name)	iper 'sacks gell. sacks gell and got pe to 1067' pe cement run 200	Size & Kind 44:" Pipe DIVISION OF CONTROL	1988 1988
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name)	iper 'sacks gell. sacks gell and got pe to 1067' pe cement run 200	Size & Kind 44:" Pipe DIVISION OF CONTROL	1988 1988
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name) (Name)	iper 'sacks gell. sacks gell and got pe to 1067' pp cement run 200	DIVISION OF CODEPARTMENT Of Comparing the second of the plugged and on plate.	988 Pulled IFT 1067 1067 1067 1067 1067 1067 1067 1067
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 selected flakes, 2 bags raw circulation material accirculation 4) Run 410 sacks of Chem Comp, pulled 4½" pind Run 800 sacks portland, 100 sack Chem Comp. 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name) (Name) (Name)	iper 'sacks gell sacks gell and got pe to 1067' pe cement run 200	DIVISION OF O DEPARTMENT O Description of Ata and a series wedge we plate welded to 2 Date plugged and on plate. As completed on the	1988 1988
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 s flakes, 2 bags raw circulation material a circulation 4) Run 410 sacks of Chem Comp, pulled 4½" pi Run 800 sacks portland, 100 sack Chem Com 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name) (Name)	iper 'sacks gell sacks gell and got pe to 1067' pe cement run 200	DIVISION OF O DEPARTMENT O Description of Ata and a series wedge we plate welded to 2 Date plugged and on plate. As completed on the	1988 1988
Formation 1) Cleaned out to a depth of 1304' 2) Run logs Gamma Ray, Neutron and 3 Arm Cal 3) Run 1297' of 4½" pipe gelled hole with 27 4 bags paper mulch, 6 sacks saw dust, 2 selected flakes, 2 bags raw circulation material accirculation 4) Run 410 sacks of Chem Comp, pulled 4½" pind Run 800 sacks portland, 100 sack Chem Comp. 5) Pumped latch down plug to 1047' 6) Run 2 3/8" tubing down 210' taged cement, sack portland and got circulation 7) Bailed water out inside 4½" pipe Coal Seams (Name) Pittsburgh Coal 954' to 964' (Name) (Name) (Name) (Name)	iper 'sacks gell sacks gell and got pe to 1067' pe cement run 200	DIVISION OF CODEPARTMENT Of Comparing the second of the plugged and on plate.	1988 1988

Notary Public

Permit No. 47-061-0867-P