

HALLS INC. SAOBS

FORM WR-38 (Affidavit of Plugging)

## STATE OF WEST VIRGINIA DEPARTMENT OF ENERGY OIL AND CAS WELLS DIVISION

LANG BROTHERS

## AFFIDAVIT OF PLUCGING AND FILLING WELL

AFFIDAVIT SHOULD BE MADE IN TRIPLICATE, one copy mailed to the Division, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Consolidation Coal Company		n Coal Company	<del></del>
Coal Operator or Owner	•	Name of Well Opera	itor
P. O. Box 1314, Morgantown, WV	26507-1314 P.O. Box 131	4, Morgantown, WV	26507-1314
Address	_	Complete Address	•
		September 29,	1994
Coal Operator or Owner	WE	LL AND LOCATION	
		le	D1 = 6 = 4 = 6
Address .	Datter	TE.	_ District
	Monong	alia	
Charles Phillips			County
Lease or Property Owne		·	
Route 1, Box 8A, Wadestown, WV	26589 WELL NO. 41	.78	
Address	`		•
		harles Phillips	Farm
		1 - 0 1	
STATE INSPECTOR SUPERVISING PI	LUGGING Trandal	Much	
	A MANT TO A VALUE	•	•
•	AFFIDAVIT	•	
STATE OF WEST VIRGINIA,	• •		•
County of Harrison	ss:		•
codiley of <u>Harrison</u>			
G. Andrew Lang	and Kevin		·
being first duly sworn accord:	ing to law depose and say tha	it they are experie	enced in the
work of plugging and filling	oil and gas wells and were en	nployed by Consol	1dation
Coal Company, well of	perator, and participated in	the work of plugg	ing and fill-
ing the above well, that said	work was commenced on the	7th day of s	eptember
19 94 and that the well wa	as plugged and filled in the	following manner:	
,			
Sand or Zone Record	Filling Material	Plugs Used	Casing
Formation			
		l Size & Kind	C36 C30
•		Size & Kind	EULLED LEFT IN
Cleaned bole with 9 7/8" bit	from surface to 923'. Reduc		PULLED LEFT IN
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7	7/8" hole from 923' to 1344'.	ed 8½"	PULLED LEFT IN
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitt:	7/8" hole from 923' to 1344'. sburgh coal from 960' to 968'	ed 8½"	euiten iefijn
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitt. Left 8" casing in hole from 1	7/8" hole from 923' to 1344'.  Sburgh coal from 960' to 968'  128' to 1297'. Ran coal	ed 8½"	eullen LEFT IN
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitt. Left 8" casing in hole from 1 protection string as follows:	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" casing in hole from 1 protection string as follows:	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cements.	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  sing. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" call 1307.53' back to surface using 250 sacks of thixatropic cement 1125.47'. Float valve at 115	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  sing. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  1.60'. Swedge at 1158.60'.	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cements.	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  ising. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  .60'. Swedge at 1158.60'.  Cement did circulate.	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemer 1125.47'. Float valve at 115 Used 1000 gallons of mud flust	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  ising. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  .60'. Swedge at 1158.60'.  Cement did circulate.	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemer 1125.47'. Float valve at 115 Used 1000 gallons of mud flush Displaced cement to 1125.47' valve at 1125.47' valve	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  ising. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  .60'. Swedge at 1158.60'.  Cement did circulate.	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" callowed by 1157.60' of 1155.47' of 1	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  ising. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  .60'. Swedge at 1158.60'.  Cement did circulate.	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" callowed by 1157.60' of 1155.47' of 1	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  ising. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  .60'. Swedge at 1158.60'.  Cement did circulate.	ed 8½"	PULLED LEFT IN 1297
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" callowed by 1157.60' of 1155.47' of 1	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  ising. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  .60'. Swedge at 1158.60'.  Cement did circulate.	ed 8½"	PULLED LEFT IN  1297!
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" callowed by 1157.60'	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and t. Latch down plug at 60'. Swedge at 1158.60'. Cement did circulate. ith water let set and bailed	Description o	PULLED LEFT IN 1297.  13 96  If Monument
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" callowed by 1157.60'	burgh coal from 923' to 1344'.  burgh coal from 960' to 968'  128' to 1297'. Ran coal  149.93' of 2 3/8" tubing  sing. Cemented hole from  630 sacks of poz mix and  t. Latch down plug at  1.60'. Swedge at 1158.60'.  Cement did circulate.  ith water let set and bailed	Description o	PULLED LEFT IN 1297!  1 1297!  1 Monument  with plaque
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1: protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemen 1125.47'. Float valve at 115: Used 1000 gallons of mud flush Displaced cement to 1125.47' of dry. TOTAL DEPTH: 1,344 feet  Coal Seams (Name) Pittsburgh (Name)	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and t. Latch down plug at 60'. Swedge at 1158.60'. Cement did circulate. ith water let set and bailed	Description o  5' of 4½" casing  stating: Consol	PULLED LEFT IN 1297!  1 1297!  1 Monument  with plaque
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1 protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemer 1125.47'. Float valve at 115 Used 1000 gallons of mud flush Displaced cement to 1125.47' dry.  TOTAL DEPTH: 1,344 feet  Coal Seams  (Name) Pittsburgh (Name)	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and t. Latch down plug at 60'. Swedge at 1158.60'. Cement did circulate. ith water let set and bailed	Description o	Monument with plaque idation Coal
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1: protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemen 1125.47'. Float valve at 115: Used 1000 gallons of mud flush Displaced cement to 1125.47' valve.  TOTAL DEPTH: 1,344 feet.  Coal Seams (Name) (Name) (Name)	7/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and 1. Latch down plug at 1.60'. Swedge at 1158.60'.  Cement did circulate.  ith water let set and bailed  960' to 968'	Description o  5' of 4½" casing stating: Consol Co. Well #4178 Permit #47-61-01	Monument with plaque idation Coal
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1: protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemer 1125.47'. Float valve at 115 Used 1000 gallons of mud flush Displaced cement to 1125.47' of dry. TOTAL DEPTH: 1,344 feet  Coal Seams (Name) (Name) (Name) (Name)	y/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and t. Latch down plug at 7.60'. Swedge at 1158.60'. The common	Description o  5' of 4½" casing stating: Consol Co. Well #4178 Permit #47-61-01	Monument with plaque idation Coal
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1: protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemen 1125.47'. Float valve at 115: Used 1000 gallons of mud flush Displaced cement to 1125.47' valve.  TOTAL DEPTH: 1,344 feet.  Coal Seams (Name) (Name) (Name)	y/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing sing. Cemented hole from 630 sacks of poz mix and t. Latch down plug at 7.60'. Swedge at 1158.60'. The common	Description o  5' of 4½" casing stating: Consol Co. Well #4178 Permit #47-61-01	Monument with plaque idation Coal
Cleaned hole with 9 7/8" bit hole to 7 7/8" and cleaned 7 Cleaned 7 7/8" hole thru Pitts Left 8" casing in hole from 1: protection string as follows: followed by 1157.60' of 4½" ca 1307.53' back to surface using 250 sacks of thixatropic cemer 1125.47'. Float valve at 115 Used 1000 gallons of mud flush Displaced cement to 1125.47' of dry. TOTAL DEPTH: 1,344 feet  Coal Seams (Name) (Name) (Name) (Name)	y/8" hole from 923' to 1344'.  sburgh coal from 960' to 968' 128' to 1297'. Ran coal 149.93' of 2 3/8" tubing using. Cemented hole from 630 sacks of poz mix and t. Latch down plug at 60'. Swedge at 1158.60'. Cement did circulate. ith water let set and bailed  960' to 968'	Description o  5' of 4½" casing stating: Consol Co. Well #4178 Permit #47-61-01	Monument with plaque idation Coal

29th day of

SEptember

Notary Public

My commission expires. June 29, 1999

MA 1. Low 635 MA Clara, WV 26609

Sworn to

47-61-01172-P